

# TONO-PEN® XL Tonometer

## User's Guide



Rx Only

**Reichert, Inc.  
3362 Walden Ave.  
Depew, NY 14043  
USA**

**www.reichert.com**

Authorized Representative for EC Regulatory Matters  
Reichert GmbH  
Hubertusstrasse 2  
D-82229 Seefeld  
Germany  
Tel: +49 8152 99 3530  
Fax: +49-8152-99 35 311

This device complies with Medical Device Directive 93/42/EEC

**CE 0120**

The following are registered trademarks of Reichert, Inc.

Reichert®  
TONO-PEN®  
OCU-FILM®

The following is a trademark of Reichert, Inc.  
OCU-CEL™

The information contained in this document was accurate at time of publication. Reichert, Inc. reserves the right to make changes in the product described in this manual without notice and without incorporating those changes in any products already sold.

© Reichert, Inc. 2006

# Table of Contents

<b>Introduction</b>	<b>4</b>
<b>Warnings and Cautions</b>	<b>6</b>
<b>Setup</b>	<b>8</b>
<b>Calibration</b>	<b>11</b>
<b>Taking a Measurement</b>	<b>13</b>
<b>Interpreting the LCD</b>	<b>16</b>
<b>Maintenance &amp; Storage</b>	<b>17</b>
<b>Troubleshooting</b>	<b>19</b>
<b>Guidance and manufacturer's declaration</b>	<b>20</b>
<b>Warranty</b>	<b>23</b>

# Introduction

## Overview

The Reichert TONO-PEN XL is a precision electronic tonometer which measures intraocular pressure (IOP). The body of the instrument is specially designed to fit comfortably in the user's hand, facilitating fast and accurate measurements. The stainless steel probe on the TONO-PEN XL contains a solid state strain gauge which converts intraocular pressure (IOP) to an electrical signal. The probe tip must be covered by a protective membrane. Reichert OCU-FILM® Tip Covers are recommended. Utilizing a sophisticated "single chip" microprocessor and electronics housed in the body of the instrument, the waveform produced by each touch to the anesthetized corneal surface is analyzed and stored for a statistical comparison process. Each single valid IOP reading is digitally displayed on the liquid crystal display (LCD). When four valid readings are obtained, the mean IOP and the standard deviation for those readings (an indication of reliability) are shown on the LCD.

## Intended Use

The TONO-PEN XL is intended for measuring IOP as a screening/monitoring tool for Glaucoma or when increased IOP is suspected.

## Components

The TONO-PEN XL unit (see Figure 1) is provided in a storage case, complete with:

- Ocu-Cel™ XL Batteries
- OCU-FILM® Tip Covers
- Stylus Blade for battery replacement
- Desiccant to keep the instrument and components dry (not shown in Figure 1)
- Instruction Manual
- Instructional DVD (not shown in Figure 1)

# Introduction



Figure 1 TONO-PEN XL Components (in Storage Case)

## Warnings and Cautions

### **WARNING: AN INSTRUCTION THAT DRAWS ATTENTION TO RISK OF INJURY OR DEATH**

WARNING: THE TONO-PEN XL SHOULD BE USED IN STRICT ACCORDANCE WITH THE INSTRUCTIONS OUTLINED IN THIS USER'S GUIDE. THE SAFETY OF THE PATIENT AND THE PERFORMANCE OF THE INSTRUMENT CAN NOT BE GUARANTEED IF USED IN A MANNER NOT SPECIFIED BY REICHERT, INC.

WARNING: THE BATTERY SHOULD ONLY BE REPLACED WITH THE BATTERY SPECIFIED IN THIS MANUAL (OCU-CEL™ XL Battery). USE OF ANOTHER BATTERY MAY CAUSE FIRE OR AN EXPLOSION.

WARNING: DO NOT PLACE A SHORTING DEVICE BETWEEN THE BATTERY TERMINALS, OR ALLOW THE BATTERY TO BECOME WET. DO NOT DISASSEMBLE OR DISPOSE OF THE BATTERY IN A FIRE. MISUSE OR IMPROPER DISPOSAL OF THIS BATTERY MAY CAUSE IT TO BECOME VERY HOT, IGNITE OR EXPLODE. DAMAGE TO THIS UNIT AND/OR SERIOUS PERSONAL INJURY MAY RESULT.

WARNING: DO NOT EXPOSE THE BATTERIES TO TEMPERATURES ABOVE 140° F. DO NOT DISASSEMBLE THE BATTERIES. DO NOT CARRY BATTERIES LOOSE IN A POCKET OR ELSEWHERE. DAMAGE TO THIS UNIT AND/OR SERIOUS PERSONAL INJURY MAY RESULT.

WARNING: IN ORDER TO ENSURE THAT CORRECT OPERATION OF THE INSTRUMENT IS MAINTAINED, AND TO GUARANTEE THE SAFETY AND RELIABILITY OF THE INSTRUMENT, ANY REPAIR OR SERVICE MUST BE PERFORMED BY REICHERT, INC. OR AN AUTHORIZED SERVICE AGENT OF REICHERT, INC.

WARNING: APPROPRIATE CLINICAL PERSONNEL ONLY SHOULD USE THIS DEVICE IN ORDER TO AVOID THE RISK OF DAMAGING A PATIENT'S EYE. BE SURE NOT TO APPLY TOO MUCH FORCE TO THE PROBE TIP AS THIS MAY CAUSE EYE INJURY. A QUICK, GENTLE TAPPING TECHNIQUE IS SUFFICIENT TO ACHIEVE MEASUREMENTS.

WARNING: OCU-FILM CONTAINS NATURAL RUBBER LATEX WHICH MAY CAUSE ALLERGIC REACTIONS. QUESTION PATIENTS ABOUT ALLERGIES TO LATEX BEFORE EXAMINING THEM WITH THE TONO-PEN XL.

WARNING: DO NOT RECHARGE THE BATTERIES. THE BATTERY IS NOT DESIGNED TO BE CHARGED BY ANY OTHER ELECTRICAL SOURCE. CHARGING COULD GENERATE GAS AND INTERNAL SHORT-CIRCUITING, LEADING TO DISTORTION, LEAKAGE, OVERHEATING, EXPLOSION OR FIRE.

WARNING: NEVER SWALLOW. ALWAYS KEEP THE BATTERY OUT OF REACH OF INFANTS AND YOUNG CHILDREN TO PREVENT IT FROM BEING SWALLOWED. IF SWALLOWED, CONSULT A PHYSICIAN IMMEDIATELY.

WARNING: IF LEAKAGE IS SUSPECTED OR YOU DETECT A STRONG ODOR, KEEP THE BATTERY AWAY FROM FIRE, BECAUSE THE LEAKED LIQUID COULD CATCH ON FIRE.

## Warnings and Cautions

**WARNING:** NEVER ALLOW LIQUID LEAKING FROM THE BATTERY TO GET IN YOUR EYES OR MOUTH. BECAUSE THIS LIQUID COULD CAUSE SERIOUS PERSONAL INJURY, IF IT DOES COME IN CONTACT WITH YOUR EYES, FLUSH THEM IMMEDIATELY WITH PLENTY OF WATER AND CONSULT A PHYSICIAN. LIKEWISE, IF THE LIQUID GETS IN YOUR MOUTH, RINSE IMMEDIATELY WITH PLENTY OF WATER AND CONSULT A PHYSICIAN.

**CAUTION: AN INSTRUCTION THAT DRAWS ATTENTION TO THE RISK OF DAMAGE TO THE PRODUCT.**

**CAUTION:** DO NOT USE ANY SOLVENTS OR STRONG CLEANING SOLUTIONS ON ANY PART OF THIS INSTRUMENT OR DAMAGE TO THE UNIT MAY OCCUR.

**CAUTION:** THE TIP OF THE TONO-PEN XL IS A SENSITIVE ELECTRONIC COMPONENT. BE CAREFUL NOT TO BUMP OR JAR THE UNIT AS THIS MAY DAMAGE THE TIP AND EFFECT OPERATION.

**CAUTION:** DO NOT IMMERSE PROBE IN FLUIDS. THIS WILL CAUSE DAMAGE TO THE ELECTRONICS AND VOID THE WARRANTY.

**CAUTION:** DO NOT STERILIZE THE PROBE. THIS WILL CAUSE DAMAGE TO THE ELECTRONICS AND VOID THE WARRANTY.

**CAUTION:** CHECK TO BE SURE THAT THE BATTERIES ARE INSTALLED CORRECTLY. INCORRECT INSTALLATION COULD CAUSE SEVERE DAMAGE TO THE ELECTRONICS AND VOID THE WARRANTY.

**CAUTION:** USE OR STORAGE OF THE TONO-PEN XL UNIT WITHOUT AN OCU-FILM TIP COVER CAN CAUSE SEVERE DAMAGE TO THE INSTRUMENT AND VOID THE WARRANTY.

**CAUTION:** REMOVAL OF THE ATTACHMENT SCREW WILL VOID THE WARRANTY.

**CAUTION:** MEDICAL ELECTRICAL EQUIPMENT NEEDS SPECIAL PRECAUTIONS REGARDING EMC AND NEEDS TO BE INSTALLED AND PUT INTO SERVICE ACCORDING TO THE EMC INFORMATION PROVIDED IN THIS GUIDE.

**CAUTION:** ELECTROMAGNETIC INTERFERENCE FROM OTHER DEVICES MAY AFFECT THIS INSTRUMENT. IF INTERFERENCE IS PRESENT, TURN OFF OTHER ELECTRONIC DEVICES, OR REMOVE THEM FROM THE IMMEDIATE AREA WHILE OPERATING THIS INSTRUMENT.

**CAUTION:** PORTABLE AND MOBILE RF COMMUNICATIONS EQUIPMENT CAN AFFECT MEDICAL ELECTRICAL EQUIPMENT.

**CAUTION:** THE TONO-PEN XL SHOULD NOT BE USED ADJACENT TO OR STACKED WITH OTHER EQUIPMENT. IF ADJACENT OR STACKED USE IS NECESSARY, THE TONO-PEN XL SHOULD BE OBSERVED TO VERIFY NORMAL OPERATION IN THE CONFIGURATION IN WHICH IT WILL BE USED.

# Setup

## Set Up Instructions

To set up the TONO-PEN XL for operation, follow the instructions listed below:

1. Remove all protective packaging materials. Remove and discard the desiccant.
2. Carefully remove the tonometer and accessories from the case.
3. Check for missing items.
4. Visually check the instrument and accessories for damage.
5. Remove the Ocu-Film Tip Cover shipped with the TONO-PEN.
6. Notify Reichert Customer Service immediately if any components are missing or damaged.
7. Install the batteries in the battery compartment (see page 9).
8. Perform the Calibration Procedure (see page 11).
9. Slide a new Ocu-Film Tip Cover over the TONO-PEN XL unit's stainless steel probe until the Ocu-Film ridge is seated in the groove (see Figure 2). The Ocu-Film Tip Cover should fit over the probe tip (see Figure 3), without being too tight. Proper fit makes contact with the transducer surface (probe post), but still has pleats along the side of the transducer head assembly.

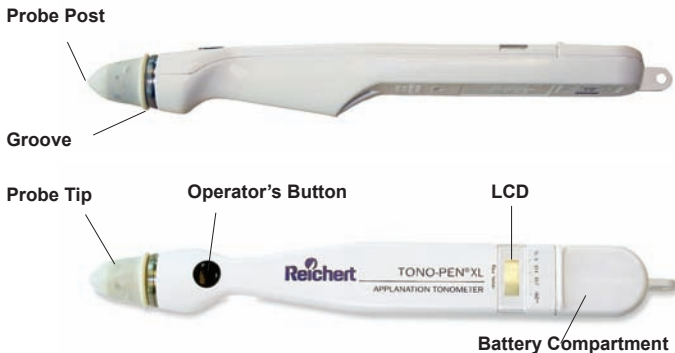


Figure 2 TONO-PEN XL Top and Side Views



## Setup



Ocu-Film Tip Cover - Correct



Ocu-Film Tip Cover - Too Loose



Ocu-Film Tip Cover - Too Tight

Figure 3 Ocu-Film Tip Cover Placement

## Battery Installation

The TONO-PEN XL is supplied with four Ocu-Cel™ XL 3.0 volt lithium manganese dioxide batteries that need to be installed in the TONO-PEN XL. It is recommended that Reichert Ocu-Cel XL Batteries be used when the batteries need replacement.

**Note: The TONO-PEN XL unit will not function properly with mercury batteries.**

## Installation Procedure

1. Locate the battery compartment (see Figure 4). Open the battery compartment by gently inserting the stylus blade (see Figure 4) in the end slot. After insertion, slowly push the stylus forward and pry the cover up to remove.
2. Using the other end of the stylus, insert the tip into the holes on the underside of the body mold. Insert the tip perpendicular into the battery removal holes on the bottom of the base housing to push the batteries out (see Figure 4).
3. Insert two batteries as shown in Figure 4 (also diagrammed on the floor of the battery compartment).
4. Replace the battery cover.

### **CAUTION**



**CHECK TO BE SURE THAT THE BATTERIES ARE INSTALLED CORRECTLY. INCORRECT INSTALLATION COULD CAUSE SEVERE DAMAGE TO THE ELECTRONICS AND VOID THE WARRANTY.**

## Setup

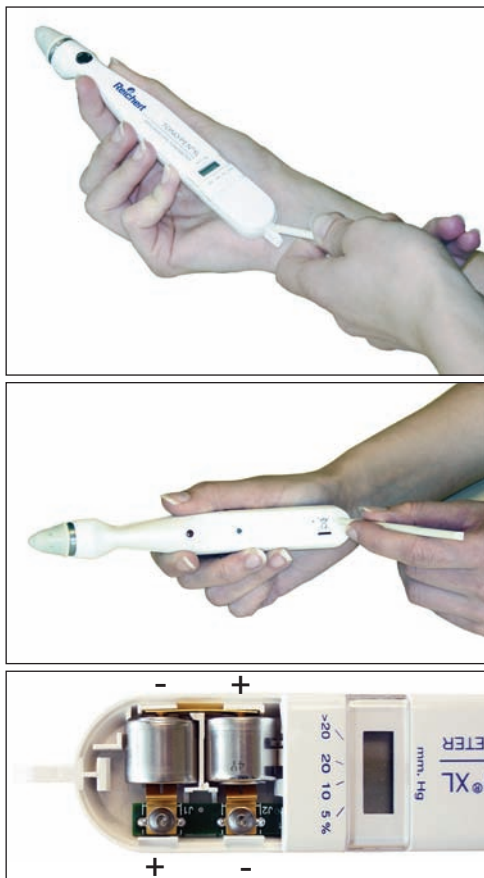


Figure 4 Replacing Batteries

# Calibration

## Calibration Procedure

The Tono Pen XL unit is internally calibrated, thus the instrument calibration should be checked only before the first use each day or in the event of unanticipated readings. Calibration must be routinely and successfully performed once daily prior to instrument use. Calibration should also be performed whenever it is indicated by the LCD display, when batteries are replaced, or after an unsuccessful calibration. It is not necessary to check calibration prior to each use:

1. Point the transducer end of the TONO-PEN straight down towards the floor (see Figure 5a).
2. Depress the Operator's Button two times rapidly. The time between the first and second button press must be between 0.5 and 1.5 seconds. The TONO-PEN will "beep" and display [CAL].
3. Wait approximately 15 seconds for the TONO-PEN to "beep". The display will change from [CAL] to [UP].
4. Immediately (within 1 second) invert the TONO-PEN smoothly, pointing the transducer end straight up (see Figure 5b).
5. A properly functioning TONO-PEN will display [Good] followed by a "beep".
6. Repeat this Calibration Procedure if [bAd] is displayed.
7. After Good is displayed, depress the Operator's Button one time and the TONO-PEN will display [8.8.8.8], followed by a single row of dashes, [- - - -], and then by a double row of dashes [====] followed by a "beep" tone, indicating the instrument is ready to measure IOP (Depressing the activation button a second time will interrupt this process and send the unit to calibration mode).



Figure 5a



Figure 5b

# Calibration

## Unsuccessful Calibration

If several consecutive attempts at checking the calibration are unsuccessful:

Loosen or remove the Ocu-Film Tip Cover from the TONO-PEN XL probe tip and repeat the calibration check.

If still unsuccessful:

Spray the probe tip with compressed gas, and repeat the calibration check.

If still unsuccessful:

Replace the batteries and repeat the calibration check.

**Note:** If [CAL] appears followed by a row of four dashes [- - - -], the unit did not go into calibration mode. To correct this, depress the button quicker two times or slower two times (see step 2 of calibration procedure).

**Note:** Do not take measurements with the instrument if two consecutive [good] calibration checks cannot be obtained. The instrument will not take a measurement when the prior calibration check was [bAd].

**Note:** If the TONO-PEN XL fails to yield a [Good] calibration, call Reichert Technical Service.

# Taking a Measurement

## Instrument Preparation

Prior to using the TONO-PEN XL for IOP measurement prepare the instrument according to the instructions below:

1. Allow the instrument to thermally stabilize at room temperature (72-82° F, 22 - 28° C) for approximately 30 minutes prior to use.
2. Remove the Ocu-Film Tip Cover from the probe. Visually inspect the tonometer's probe tip for cracks, chips or other irregularities. If irregularities are present, contact Reichert. **Do not use the instrument.**
3. If the probe tip passes a visual inspection, proceed.
4. To help prevent build-up of debris around the probe post, spray the probe tip with compressed gas before the first use of the day.
5. Cover the TONO-PEN XL probe tip with a new Ocu-Film Tip Cover. Reichert Ocu-Film Tip Covers are:
  - Individually wrapped and non-sterile sanitized
  - For Single Use only
6. Perform daily routine calibration (See page 11)

**Note:** Calibration should only be performed on the TONO-PEN once daily, unless otherwise indicated by the instrument. The TONO-PEN does not require calibration after every patient examination.

### CAUTION



*Do not use the instrument without an Ocu-Film Tip Cover. Use without an Ocu-Film Tip Cover will damage the instrument and void the Warranty.*

## Performing IOP Measurements

After the TONO-PEN XL has been prepared for operation, the patient must be prepared and then IOP measurements can be performed.

### CAUTION



*Ocu-Film contains natural rubber LATEX which may cause allergic reactions. Question patients about allergies to Latex before examining them with the TONO-PEN XL.*

To prepare a patient for an IOP measurement:

1. Instill a drop of topical anesthetic onto the eye to be examined.
2. Position the patient, seated or supine, in front of a fixation target; or have the patient fixate on a point of reference (i.e. ear, nose, distant object) to minimize eye movement.

**Note:** The TONO-PEN XL unit will function in any stable position.

## Taking a Measurement

To perform an IOP measurement:

1. Instruct the patient to look straight ahead at the fixation target with his/her eyes fully open.
2. Hold the TONO-PEN XL unit as you would a pencil.
3. Position yourself to facilitate viewing of the probe tip and patient's cornea where contact will be made. For normal corneas, central corneal contact is recommended.
4. Brace the heel of your hand on the patient's cheek for stability while holding the TONO-PEN XL unit perpendicular to and within 1/2 inch of the patient's cornea. (See Figure 6 for correct positioning.)

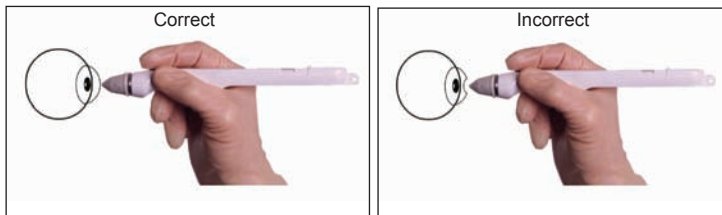


Figure 6 Corneal Applanation

5. To initiate an IOP measurement, depress the Operator's Button once, and only once.
6. Initially you will see a brief display of [8.8.8.8]. This is a self-test of the LCD (Liquid Crystal Display). If any of the LCD segments are not displayed, the TONO-PEN requires service.
7. If a momentary display of [CAL] is seen, followed immediately by a single row of dashes [- - -], it indicates that the TONO-PEN requires calibration before it will measure.
8. If a double row of dashes [====] is seen and a "beep" tone is heard, it indicates that the TONO-PEN is ready to measure IOP. Proceed with applanation within 15 seconds.
9. Note: After acquiring the double row of dashes [====], if more than 15 seconds elapses prior to applanation, the TONO-PEN will not measure. The software will have initiated a battery-saving function, indicated initially by the display of a single row of dashes [- - -], then followed in sequence by a blank display [ ]. A new IOP measurement can be initiated by depressing the operator's button once.

## Taking a Measurement

**Note:** Anytime the operator's button is depressed twice within 1.5 seconds, (which may be caused by operator's inadvertent pressure on the button) the software will interpret this as a demand for calibration. Then a sustained display of [CAL] will be seen which initiates the calibration sequence. The calibration sequence must be successfully completed before further measurements can be accomplished.

10. Once activated, after [====] is displayed and a "beep" tone is heard, touch the TONO-PEN XL unit to the cornea lightly and briefly, then withdraw. Repeat several times. The corneal surface needs only to be momentarily contacted; indentation is not required and may lead to inaccurate readings.
11. A chirp will sound and a digital IOP measurement will be displayed each time a valid reading is obtained. The single horizontal bar at the bottom of the LCD, indicating statistical reliability, will not be displayed with each single IOP measurement.
12. After four (4) valid readings are obtained, a final beep will sound and the averaged measurement will appear on the LCD along with the single bar denoting statistical reliability.

**Note:** If a single row of dashes [- - -] appears on the LCD after the final beep, an insufficient number of valid readings was collected. If this occurs, repeat the patient examination procedure, starting at step 1.

13. To take another measurement, reactivate the TONO-PEN XL unit by pressing and releasing the activation switch as described in step 5.

**Note:** If not reactivated within 25 seconds, the TONO-PEN XL unit will automatically turn off and the LCD will clear, placing the device in sleep mode, to conserve battery life. If this occurs, activate the Tono Pen XL by pressing the Operator's Button once.

14. Replace the Ocu-Film Tip Cover before using the TONO-PEN XL unit on another patient and before storage.
15. Note: Failure to replace the Ocu-Film Tip Cover between patients may result in unreliable readings of IOP by allowing debris to enter the transducer assembly.

**Note:** A reused Ocu-Film Tip Cover may leak. This may cause damage to the strain gauge and void the Warranty.

## Interpreting the LCD

The number display represents IOP in millimeters of mercury (mmHg.) A number with a single horizontal bar displayed at the bottom of the LCD is an average of the valid measurements. A number without the single bar is a single measurement of IOP. (See Figure 7).

The display of one of four horizontal bars located along the lower border of the LCD block indicates the statistical reliability of the averaged measurement. For example, if the 5% bar is displayed, the standard deviation of the valid measurements is 5% or less of the number shown.

If the reliability measure is 20% or > 20%, a repeat measurement is recommended. A single row of dashes [ - - - ] indicates that the instrument is activated.

Two rows of dashes [====] followed by a “beep” indicates that the instrument is ready to take measurements.

“CAL” indicates that the instrument is in the process of calibration check or the instrument needs to undergo calibration check procedure. If “CAL” is displayed following a long beep and “- - -”, the latter is the case. A “Good” calibration check must be obtained.

“Lob” indicates the need to replace both batteries prior to using the instrument.

“UP” indicates that the instrument is being calibrated and the probe tip should be turned from pointing down to pointing up.

“Good” indicates the calibration check procedure was successful. After two “Good” calibration checks, the TONO-PEN XL unit is ready for use in patient examinations.

“bAd” indicates the calibration check procedure was unsuccessful and must be repeated.



Figure 7 LCD  
(Single Measurement)



# Maintenance & Storage

## Instrument Storage

1. Cover the probe tip with an Ocu-Film Tip Cover for protection.
2. If the TONO-PEN XL unit is not to be used until a subsequent day, the instrument and accessories should be replaced in the storage case provided.
3. If the TONO-PEN XL unit is not to be used for an extended period of time, remove the batteries from the instrument.

## Maintenance Procedures

Maintenance that should be performed on the TONO-PEN XL consists of activities such as protecting the probe tip, keeping surfaces free of dust and dirt and storing in a dry and cool place so as not to adversely affect electronic parts, and replacing the batteries.

Keep the probe tip protected with an Ocu-Film Tip Cover when in use or in storage. Avoid any contact with the probe tip when not protected by an Ocu-Film Tip Cover. The probe post must be cleaned only with optical quality compressed gas before the first use each day, before instrument storage, in the event of unanticipated readings or if a “Good” calibration check cannot be obtained. To clean the probe post:

1. Remove the Ocu-Film Tip Cover.
2. Spray the compressed gas onto the probe tip for approximately 2 seconds.
3. Wait 3 minutes to allow the instrument to thermally stabilize.
4. Cover the TONO-PEN XL unit’s probe tip with a new Ocu-Film Tip Cover.

## TONO-PEN XL Body

Avoid any shock or excessive vibration which will damage the unit. Clean with a non-abrasive, dry cloth.



### **CAUTION**

**DO NOT IMMERSE TONO-PEN XL BODY IN FLUIDS. THIS WILL CAUSE DAMAGE TO THE ELECTRONICS AND VOID THE WARRANTY.**

## Battery Replacement

The batteries need replacing when multiple beeps sound and “Lob” appears on the LCD upon depressing the activation switch. Occasionally, a noticeable slowing in the calibration check process or in activating the instrument for taking measurements may suggest that the batteries need replacing. Always replace both batteries. Do not mix used and new batteries in the instrument. Reichert OCU-CEL XL batteries are recommended.

**Note: The instrument will not function properly when mercury batteries are used.**

## Maintenance & Storage

Replace the batteries using the procedure described on page 9. If the instrument is not to be operated for an extended period of time, remove both batteries. This will avoid possible damage to the instrument due to battery leakage

### Attachment Screw

The attachment screw, located on the underside of the instrument, is used to protect the sensitive electronics against intrusion and should be removed only by the manufacturer.

**Note: Removal of the Attachment Screw will void the warranty.**

## Specifications

Dimensions	7 1/4" X 1" X 7/8"
Weight	59.4g (2.1 oz.)
Range of Measurement	5 - 80 mmHg
Power Source	3V Lithium Manganese Dioxide Batteries (QTY 2)

## Symbols



ATTENTION, SEE INSTRUCTIONS FOR USE

**REF**

CATALOG NUMBER

**SN**

SERIAL NUMBER



DATE OF MANUFACTURE



LOT NUMBER



WASTE OF ELECTRICAL AND ELECTRONIC EQUIPMENT

SYMBOLS FOR OCU-FILM ONLY



DO NOT REUSE. SINGLE USE



USE BY

# Troubleshooting

## Overview

This section provides a guide for troubleshooting some basic TONO-PEN XL operational problems. If a problem persists after using this guide contact Reichert technical service.

**Table 6-1: TONO-PEN XL Troubleshooting Guide**

Symptom	Probable Cause	Correction
"Lob" Batteries are displayed	Low Batteries	Replace batteries
Noticeable slowing in the calibration check process, in activating instrument	Batteries are low	Replace batteries
	Compressed air cleaning has lowered the temperature of the instrument	Allow TONO-PEN XL unit to warm to room temperature
Multiple inaccurate readings	Improper technique	Review "Taking a Measurement" section or watch Instructional DVD
	Old or improperly applied Ocu-Film Tip Cover	Replace Ocu-Film Tip Cover
	Batteries are low	Replace batteries
	Need to check calibration	Perform calibration check procedure (see page 11)
	Debris around probe post	Clean with compressed gas (see page 17 for procedure)
	Mechanical or electronic damage	Arrange for repair through Reichert Technical Service
No beeps and/or no dashes upon activation	Activation switch not depressed long enough	Depress activation switch longer
	Incorrect battery installation	Check batteries
	Batteries are low	Replace batteries
	Mechanical or electronic damage	Arrange repair through Reichert Technical Service
Unable to obtain "Good" calibration check	Improper technique	Review page 11 or watch Instructional DVD
	Dirty transducer	Clean with compressed gas (see page 17 for procedure)

## Guidance & Manufacturer's Declaration

<b>Guidance and manufacturer's declaration – electromagnetic immunity - Part I</b>			
The TONO-PEN is intended for use in the electromagnetic environment specified below. The customer or the user of the TONO-PEN® XL should assure that it is used in such an environment.			
<b>Immunity test</b>	<b>EN 60601 test level</b>	<b>Compliance level</b>	<b>Electromagnetic environment - guidance</b>
Electrostatic discharge (ESD) EN 61000-4-2	±6 kV contact  ±8 kV air	±6 kV contact  ±8 kV air	Floors should be wood, concrete, or ceramic tile. If floors are covered with synthetic material, the relative humidity should be at least 30 %.
Power frequency (50/60 Hz) magnetic field EN 61000-4-8	3 A/m	3 A/m	Power frequency magnetic fields should be at levels characteristic of a typical location in a typical commercial or hospital environment.

<b>Guidance and manufacturer's declaration – electromagnetic emissions</b>		
The TONO-PEN is intended for use in the electromagnetic environment specified below. The customer or the user of the TONO-PEN® XL should assure that it is used in such an environment.		
<b>Emissions</b>	<b>Compliance</b>	<b>Electromagnetic environment - guidance</b>
RF emissions CISPR 11	Group 1	The TONO-PEN® XL uses RF energy only for its internal function. Therefore, its RF emissions are very low and are not likely to cause any interference in nearby electronic equipment.
RF emissions CISPR 11	Class B	The TONO-PEN® XL is suitable for use in all establishments, including domestic establishments and those directly connected to the public low-voltage power supply network that supplies buildings for domestic purpose.
Harmonic emissions EN 61000-3-2	N/A	
Voltage fluctuations EN 61000-3-3	N/A	

## Guidance & Manufacturer's Declaration

### Recommended separation distances between portable and mobile RF communications equipment and the TONO-PEN

The TONO-PEN® XL is intended for use in the electromagnetic environment in which radiated RF disturbances are controlled. The customer or the user of the TONO-PEN® XL can help prevent electromagnetic interference by maintaining a minimum distance between portable and mobile RF communications equipment (transmitters) and the TONO-PEN as recommended below, according to the maximum output power of the communications equipment.

Rated maximum power of transmitter <b>W</b>	Separation distance according to frequency of transmitter (meters)		
	150 kHz to 80 MHz $d = 1.2 \sqrt{P}$	80 MHz to 800 MHz $d = 1.2 \sqrt{P}$	800 MHz to 2.5 GHz $d = 2.3 \sqrt{P}$
0.01	0.12	0.12	0.23
0.1	0.38	0.38	0.73
1	1.2	1.2	2.3
10	3.8	3.8	7.3
100	12	12	23

For transmitters rated at a maximum output power not listed above, the recommended separation distance  $d$  in meters (m) can be estimated using the equation applicable to the frequency of the transmitter, where  $P$  is the maximum output power rating of the transmitter in watts (W) according to the transmitter manufacturer.

NOTE 1 At 80 MHz and 800 MHz, the separation distance for the higher frequency range applies.

NOTE 2 These guidelines may not apply in all situations. Electromagnetic propagation is affected by absorption and reflection from structures, objects and people.

# Guidance & Manufacturer's Declaration

Guidance and manufacturer's declaration – electromagnetic immunity - Part II			
The TONO-PEN® XL is intended for use in the electromagnetic environment specified below. The customer or the user of the TONO-PEN should assure that it is used in such an environment.			
Immunity test	EN 60601 test level	Compliance level	Electromagnetic environment - guidance
Conducted RF EN 61000-4-6	3 Vrms 150 kHz to 80 MHz	N/A	Portable and mobile RF communications equipment should be used no closer to any part of the TONO-PEN, including cables, than the recommended separation distance calculated from the equation applicable to the frequency of the transmitter.  Recommended separation distance  $d = 1.2 \sqrt{P}$
Radiated RF EN 61000-4-3	3 V/m 80 MHz to 2.5 GHz	3 V/m	$d = 1.2 \sqrt{P}$ 80 MHz to 800 MHz $d = 2.3 \sqrt{P}$ 800 MHz to 2.5 GHz
<p>where P is the maximum output power rating of the transmitter in watts (W) according to the transmitter manufacturer and d is the recommended separation distance in meters (m). Field strengths from fixed RF transmitters, as determined by an electromagnetic site surveys, should be less than the compliance level in each frequency range.</p> <p>Interference may occur in the vicinity of equipment marked with the following symbol:</p>			
<p>NOTE 1 At 80 MHz and 800 MHz, the higher frequency range applies.</p> <p>NOTE 2 These guidelines may not apply in all situations. Electromagnetic propagation is affected by absorption and reflection from structures, objects and people</p>			
<p>For transmitter Field strengths from fixed transmitters, such as base stations for radio (cellular/cordless) telephones and land mobile radios, amateur radio, AM and FM radio broadcast and TV broadcast cannot be predicted theoretically with accuracy. To assess the electromagnetic environment due to fixed RF transmitters, an electromagnetic site survey should be considered. If the measured field strength in the location in which the TONO-PEN is used exceeds the applicable RF compliance level above, the TONO-PEN® XL should be observed to verify normal operation. If abnormal performance is observed, additional measures may be necessary, such as re-orienting or relocating the TONO-PEN® XL.</p> <p>Over the frequency range 150 kHz to 80 MHz, field strengths should be less than 3 V/m.</p>			

# Warranty

This product is warranted by Reichert, Inc. against defective material and workmanship under normal use for a period of one year from the date of invoice to the original purchaser. (An authorized dealer shall not be considered an original purchaser.) Under this warranty, Reichert's sole obligation is to repair or replace the defective part or product at Reichert's discretion.

This warranty applies to new products and does not apply to a product that has been tampered with, altered in any way, misused, damaged by accident or negligence, or which has had the serial number removed, altered or effaced. Nor shall this warranty be extended to a product installed or operated in a manner not in accordance with the applicable Reichert instruction manual, nor to a product which has been sold, serviced, installed or repaired other than by a Reichert factory, Technical Service Center, or authorized Reichert Dealer.

Lamps, bulbs, charts, cards and other expendable items are not covered by this warranty.

All claims under this warranty must be in writing and directed to the Reichert factory, Technical Service Center, or authorized instrument dealer making the original sale and must be accompanied by a copy of the purchaser's invoice.

This warranty is in lieu of all other warranties implied or expressed. All implied warranties of merchantability or fitness for a particular use are hereby disclaimed. No representative or other person is authorized to make any other obligations for Reichert. Reichert shall not be liable for any special, incidental, or consequent damages for any negligence, breach of warranty, strict liability or any other damages resulting from or relating to design, manufacture, sale, use or handling of the product.

## **PATENT WARRANTY**

If notified promptly in writing of any action brought against the purchaser based on a claim that the instrument infringes a U.S. Patent, Reichert will defend such action at its expense and will pay costs and damages awarded in any such action, provided that Reichert shall have sole control of the defense of any such action with information and assistance (at Reichert's expense) for such defense, and of all negotiation for the settlement and compromise thereof.

## **PRODUCT CHANGES**

Reichert reserves the right to make changes in design or to make additions to or improvements in its products without obligation to add such to products previously manufactured.

---

## **Customer Service**

**1-800-TONO-PEN**  
**[www.tono-pen.com](http://www.tono-pen.com)**

## **Technical Support**

**1-888-849-8955**  
**Fax: 716-686-4545**

Reichert, Inc.  
3362 Walden Ave.  
Depew, NY 14043  
USA

[www.reichert.com](http://www.reichert.com)

**CE 0120**